

NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

WARTIME REPORT

ORIGINALLY ISSUED

March 1946 as Memorandum Report E6B28

INVESTIGATION OF ICE FORMATION IN THE INDUCTION

SYSTEM OF AN AIRCRAFT ENGINE

I - GROUND TESTS

By Henry A. Essex, Edward D. Zlotowski and Carl Ellisman

Aircraft Engine Research Laboratory Cleveland, Ohio

LANGER BRAGRELL AZRONAUTÁJÁ LAJORATORY

Langley Field, Va.



WASHINGTON

NACA WARTIME REPORTS are reprints of papers originally issued to provide rapid distribution of advance research results to an authorized group requiring them for the war effort. They were previously held under a security status but are now unclassified. Some of these reports were not technically edited. All have been reproduced without change in order to expedite general distribution.

MACA MR No. E6B28

MACA AIRCPAFT MIGINE RESMARCH LABORATORY

MEMORANDUM REPORT

for the

Air Technical Service Command, Army Air Forces

INVESTIGATION OF ICE FORMATION IN THE INDUCTION

SYSTEM OF AN AIRCRAFT ENGINE

I - GROUND TESTS

By Henry A. Essex, Edward D. Zlotowski and Carl Ellisman

SUMMARY

Ground tests were conducted on a twin-engine fighter airplane to study icing of an induction system incorporating an exhaust-driven turbosupercharger. The ground tests were made to determine the disposition of free water in the induction system of the airplane, to determine the charge-air heat rise available from the turbosupercharger, and to correlate actual airplane-test results with those of laboratory tests.

The icing characteristics of the airplane were studied at engine powers that varied from idling to take-off power with simulated-rain conditions of moderate, heavy, and excessive rain. The effect of the intercooler on the heat content of the charge air was studied at three power settings representative of the full range of engine power. Ambientair temperature varied from 23° to 37° F.

The results obtained in the ground tests indicate that the induction system is susceptible to serious icing only at low engine powers with high water-ingestion rates. The configuration of the induction system is such that the water is removed from the charge air before it reaches the carbureter deck, except when the engine is operated at manifold pressures of 40 inches of mercury and above in simulated excessive rainfall (2 grams/cu m).

1

The ground-test results were in agreement with the curves of limiting-icing conditions of temperature and humidity determined in the laboratory. In the ground-test runs during which the intercooler flap was closed, approximately 85 percent of the heat added to the charge air by the turbosupercharger was available for ice prevention or de-icing at the curburetor deck.

IMPRODUCTION

Induction systems that incorporate turbosuperchargers. The susceptibility to icing of an induction system with an exhaust-driven turbosupercharger has not been previously investigated. At the request of the Air Technical Service Command, Army Air Forces, laboratory tests were conducted at the NACA Cleveland laboratory of the carburetor and engine supercharger section of the fighter airplane induction system (reference 1). The tests of reference 1 and unpublished tests on a complete engine have demonstrated that dangerous ice formations can occur over a wide range of carburetor—air temperature and humidity.

The ground tests reported herein were made prior to flight tests with the following objectives: (a) to determine what happens to the simulated rain that is sprayed into the induction-system entrance; (b) to obtain data for the determination of the heat rise through the induction system from the turbosupercharger; and (c) to provide data for a preliminary correlation of laboratory and airplane test results. The tests were made from December 1944 to February 1945 in order that the free-air temperatures would be as close to 32° F as possible. Water was injected into the air scoop at rates of 0.275, 0.550, and 1.10 pounds per minute to simulate flight through moderate, heavy, and excessive rain, respectively. The icing characteristics of the airplane induction system were studied at engine 'powers that varied from idling to take-off.

APPARATUS AND LITSTRUMENTATION

The right engine installation of a twin-engine fighter airplane was selected for testing because the single generator of the electrical system is driven by the left engine. In the event of failure of the test engine, electrical power for the operation of the accessories could be supplied by the left engine and in the proposed flight tests level flight could be maintained with one engine up to an altitude of about 25,000 feet.

The induction system (fig. 1) of each engine installation consists of an external air-intake scoop, an exhaust-criven turbosupercharger, a core-type intercooler, an injection-type carburetor, an ongine-stage supercharger, and interconnecting ducting. Charge cir coming through the external scoop as ram air can be taken directly into the turbosupercharger or diverted by means of a selective control into the wheel-well space where it passes through an air filter and then into the turbosupercharger. The turbosuperchargers are mounted on the toos of the tail booms. Control of the turbines is achieved by a linkage that connects the turbine we ste gate to the carburetor throttle. This linkage is so adjusted that, when the carburetor throttles are set to approximately the two-thirds open position, the turbine waste gate starts to close. The carburetor throttle angle and the turbine waste-gate angle of the test engine were indicated in the cockpit by means of position indicators installed for the tests.

The simulation of rain was accomplished by injecting water from sprays at the air-scoop entrance and at the intercooler cooling-air-duct entrance. Water-flow rates were measured by means of an orifice plate in the water line to the air scoop and one in the water line to the cooling-air duct of the intercooler. The differential pressures across the orifices were applied to pressure transmitters, which indicated the flow on calibrated gages that had been installed in the cockpit. The temperature of the water was measured at the storage tank and at both spray bars.

Sensitive indicating instruments were installed in the cockpit in order that symptoms of iding could be observed during the ground tests and later during the flight tests. Sensitive manifold-pressure gages were installed on both engines and differential-pressure gages indicated the charge-air pressure drop across the intercoolers. Instrumentation was provided for the measurement and automatic recording of charge-air tomograture, pressure, and humidity at significant points in the induction system. The stations (fig. 1) at which the measurements were made were the air-scoop entrance (station 1), the turbosupercharger entrance (station 2), the intercooler entrance (station 3), and the carbureter deck (station 4). In addition, the static pressure was measured immediately below the carbureter and in the engine manifold. Fuel-air mixture temperatures were measured both at the

supercharger inlet elbow and in the manifold downstream of the engine supercharger. Other temperatures that were recorded include intercooler cooling-air temperature, fuel temperature, accessory-compartment air temperature, and alternate air temperature measured at the filter inlet. Iron-constantan thermocouples were used to measure all temperatures.

Humidity was determined by conducting samples of charge air to a dev-point meter. The entrances of the sampling tubes were shielded to prevent water droplets from being taken in with the air and the water vapor. Free-air humidity was taken to be the same as that of the air entering the scoop upstream of the point of water injection. The automatic instruments installed in the airplane satisfactorily recorded the test data and were considered suitable for future flight tests as well as for ground tests.

Observations of the free water in the ducting were made through transparent sections in the ducts and through a window in the outboard side of the right engine nacelle (figs. 1 and 2). The rain-separation effectiveness of the induction system was studied by putting drains at the lowest point of the plenum chamber at the bottom of the intercooler, which is the lowest point in the induction system.

The cooling of the engine and the accessories was produced by the propeller slipstream at low powers and supplemented by a cooling-air blower at high powers. (See fig. 2.)

The fuel used throughout the test program conformed to specification ALT-T-28, Amendment-2.

METEOD AND TESTS

In order to make the test conditions as uniform as possible, tests were rin on days when the outside-air temperature was close to 32° F. The air temperatures actually varied between 23° and 37° F.

The simulated-rain water-spray rates used in these tests were calculated by assuming that the rate of water ingestion in flight was directly proportional to the airspeed of the airplane, the projected frontal area of the scoop entrance, and the rain density. These assumptions are valid with rain drops larger than 400 microns. Drops of this size are frequently prevalent in rains of the intensities simulated in these tests. Water-ingestion

rates were calculated for a flight condition in which the true airspeed was 350 miles per hour and the rain densities were 0.5, 1.0, and 2.0 grams per cubic meter. These rain densities correspond approximately to moderate, heavy, and excessive rain, respectively. (See reference 2.) The scoop water-injection rates were 0.275, 0.550, and 1.10 pounds per minute for rain densities of 0.5, 1.0, and 2.0 grams per cubic meter, respectively. The area of the intercooler cooling-air duct entrance was approximately twice that of the scoop and therefore the water-injection rates were doubled for the intercooler duct.

The values of engine speed and manifold pressure prescribed in the pilot's operating instructions were used for take-off, normal rated, and high and low cruise power conditions. At the lowest powers, the manifold pressure was set and the speed used was the lowest that would give smooth operation. The engine speeds corresponding to the manifold pressures selected are listed in the following table:

Manifold pressure (in. Hg absolute)	Engine speed (rpm)	Ergine power
20	(a) (a)	
25 30	2200	Low cruise
35	2300	High cruise
40 43.5	2600 2600	Normal rated
50	2800	TIOTHEST LABOU
54	3000	Take-off

Engine speed governed by necessity of smooth operation.

Ground tests were run to determine the effect of the various simulated-rain ingestion rates on the charge-air conditions throughout the induction system. Four sories of tests represent conditions of no rain (series A), moderate rain (series B), heavy rain (series C), and excessive rain (scries D); each series comprised eight runs at the power conditions previously specified (table I). In order to impose the most severe icing conditions possible at the carburctor, the intercooler flap was left in the full-open position in the four series of tests.

The test runs were continued as long as possible to insure stabilization of the charge-air conditions. When no free water

NACA MR No. E6B28

was introduced, 3 minutes was sufficient but 6 minutes was the lergth of run used when water was injected and the engine was operated above high cruise power. At low powers, when the vibration of the grounded airplane was slight, the tests were continued for 10 minutes.

The effect of the intercooler flap opening on charge-air cooling was studied in ground test series E (table I). This series consisted of nine runs with 1.10 pounds of water per minute injected into the air scoop during all runs. At a manifold pressure of 2C inches of mercury, one run was made with the intercooler flap open and no water injected into the intercooler cooling air, another run with no water injected into cooling air but with the flap closed, and a third run with the flap closed and 2.20 pounds per minute of water sprayed into the intercooler cooling duct. These tests were repeated at manifold pressures of 35 and 50 inches of mercury. The passage of water through the ducts was observed through the observation ports. At the end of each run the water that collected in the intercooler plenum chamber was measured.

RESULTS AND DISCUSSION

The results of these ground tests are presented in table I and in figures 3 to 10.

<u>Disposition of water</u>. - Coservations made during the tests and an analysis of the test data established the disposition of the free water in the induction system. The water was observed to follow three courses:

- 1. A portion of the water that was sprayed into the scoop leaked out into the wheel well through the alternate air valve (fig. 1). This leakage was greatest during operation at low engine power when the induction-system air velocities were lowest.
- 2. Some of the water was swept along the walls of the intercooler duct and was collected in the plenum chamber at the bettem
 of the intercooler. The volume of the plenum chamber was calculated to be 360 cubic inches and the greatest volume of water
 collected after 10 minutes of operation was 43.8 cubic inches.
 In some cases water was blown out of the intercooler toward the
 carbureter, although the intercooler plenum chamber was far from
 filled. At high engine powers the resulting high air velocities
 in the intake ducting caused this blowing over of water.
- 3. Part of the water injected into the air scoop evaporated and was carried through the induction system as vapor.

Moisture content at the carburetor was computed on the basis of vapor content alone for all runs; therefore, the values do not represent the total amount of moisture if water was present.

The approximate free-water disposition in the induction system is shown in figure 3 for the three simulated-rain intensities of these tests. The results indicate that at low manifold pressure (at low charge-air flow rates) practically all of the free water leaks out of the induction system before it reaches the intercooler and very little is vaporized into the charge air. For this reason, large percentages of the water injected cannot be accounted for. The maximum amount of free water in the intercooler plenum chamber never exceeded 16 percent of the initial amount injected.

At high manifold pressures with simulated excessive rain, the charge air at the carburetor deck was saturated and some free water was observed passing from the intercooler to the carburetor deck. At a manifold pressure of 40 inches of mercury and above with simulated heavy and moderate rain, however, the entire amount of injected water was evaporated. The value of manifold pressure at which all the free water was evaporated increased with the amount of injected water, as would be expected.

During these ground tests the turbosupercharger began effective operation at a manifold pressure of about 50 inches of mercury. Because the manifold pressure at which turbosupercharging starts reduces as altitude increases, the enthalpy of the charge air at the carburetor deck is probably greater at altitude than at sea level for a given manifold pressure and charge-air inlet temperature. This enthalpy increase represents an increase in the capacity of the charge air for evaporating water. It is therefore reasonable to expect that the charge-air flow rate or manifold pressure at which all the ingested rain water becomes evaporated would be lower at altitude than at sea level for a given rain intensity.

Heat rise cvailable. - The turbosupercharger put an appreciable amount of heat into the charge-air stream even when the turbine was idling. At the pressure altitudes of these tests (150 to 1025 ft), as previously mentioned, the waste gate did not start to close until the manifold pressure reached approximately 50 inches of mercury; at higher altitudes, the wider throttle openings necessary to obtain the desired manifold pressures would cause the turbine waste gate to start closing at a lower manifold pressure and thereby increase the heat rise from the turbosupercharger.

Under the ground-test conditions, the heat input by the turbosupercharger remained practically constant at a value of approximately 4.5 Ftu per pound of charge air up to a manifold pressure

of 40 inches of mercury. Above 40 inches of mercury, the heat input increased to approximately 11.0 Etu per pound of charge air at a manifold pressure of 54 inches of mercury. These heat increments occurred regardless of the rate of water injection as shown in figure 4.

Although cooling is the function of the intercooler, it is desirable under icing conditions to retain enough of the heat added by the turbosupercharger to prevent icing. As the air passed through the intercooler, much of the heat input was removed except in the cases in which the intercooler flap was in the closed position at low powers. (See fig. 5(a).)

At each of the three power conditions in figure 5, results are shown of a run in which no rain simulation was used and the intercooler flap was full open, of another run in which an excessive rain was simulated with full-open intercooler flap, and of a third run in which the excessive rain was simulated with intercooler flap closed. With the intercooler flap closed, only approximately 65 percent of the heat supplied by the turbosuper-charger was retained after passing the intercooler at the high power runs in which the cooling blower was used.

During the tests at manifold pressures of 20 and 35 inches of mercury (figs. 5(a) and 5(b)), the cooling-air flow to the intercooler was maintained only by the propellor slipstream; whereas, at the high powers (manifold pressure, 40 in. Hg absolute and above) the cooling-air flow was increased as a result of the operation of the cooling blower. It is expected that the air flow through the intercooler was lower in all these ground tests than would be obtained in flight and that the charge-air enthalpy reduction in the intercooler would be greater in flight than was obtained in the ground tests.

Results of icing tests. - Ground-test results of carburetor icing are classified as no icing, visible icing, and serious icing. Visible icing could not be detected by observation because the carburetor and engine supercharger were not accessible for visual inspection but manifold-pressure and air-flow loss indicated this type of icing. It is therefore possible that small ice formations were present in some runs classified as no icing, which fell into the visible-icing region as determined from laboratory icing tests. The criterion for serious icing in the ground tests was similar to that used in the laboratory tests of reference 1, that is, a 2-percent reduction of initial air flow within the period of the test. Although the test period of the ground tests was only 10 minutes, the ground tests were comparable with the laboratory tests because the air-flow reduction (if any) usually occurred within the first 10 minutes of operation in the laboratory tests.

The limiting-icing-condition curves of carburetor-air temperature and moisture content as determined in the laboratory (reference 1) for the low cruise, high cruise, and rated power conditions of encine operation are reproduced in figures 6, 7, and 8, respectively. The conditions at the carburetor deck produced by the operation of the engine during the ground tests are presented on these limiting-condition curves for the corresponding engine powers.

The tomperatures and moisture contents of the charge air at the scoop entrance during all the tests with simulated-rain injection were such that sovere icing would have occurred at or downstream of the carburctor had the air stream passed directly to the carburetor. The removal of water by the induction system end the heat input by the turbosupercharger produced less severe conditions at the carburctor and only at low cruise power were the conditions at the carburetor deck in the serious-icing region. As indicated in figure 6, the ground-test runs that produced carburetor-deck conditions within the laboratory-determined seriousicing range resulted in serious carbureter icing. Time histories of the low-cruise-power runs in which there were indications of icing are shown in figure 9. Ground tests at low cruiso power that showed either indications of slight icing (fig. 9(b)) or no indications of icing fell in the laboratory-determined visibloicing region (fig. 6).

Data from ground tests at high cruise power when plotted on the corresponding laboratory-determined limiting-conditions curves (fig. 7) also show that the runs that indicated slight icing (figs. 10(a) and 10(b)) fall in the visible-icing region and that one run, which showed no indication of icing, fell into the no-visible-icing region. No high-cruise-power runs produced carburetor-dock conditions conducivé to serious icing and none of the runs displayed symptoms of serious icing.

The runs at normal rated power that showed no indication of icing fell in the region of visible icing, as shown in figure 6. The one run made with simulated excessive-rain rate, however, did show symptoms of serious icing (fig. 10(c)) but this indication of serious icing may have been caused by an unstable engine condition or it may be a borderline serious-icing condition because it is very close to the serious-icing region (fig. 8).

The test results indicate that there is a close correlation between the laboratory-determined limiting conditions and the carbureter-deck conditions, which produce the different classes of icing in the airplane-engine induction system during ground expertion. If the effect of the different components of the induction system on the temperature and humidity of the air stream is known, the susceptibility of the induction system to icing can be predicted.

Icing other than the previously mentioned carbureter icing occurred in the induction system during the ground tests. Small formations of impact icing occurred at the bend in the air-scoop intake and around the alternate air valve leading into the whoel well and some formations occurred in the intercooler cooling-air duct. The formations of ice were small, but difficulty in opening the alternate cir valve was encountered in those runs in which ice had formed around the valve.

SULFARY OF RESULTS

The following results were obtained from ground tests made on a twin-engine fighter airplane under artificial conditions representing only an approximate simulation of flight:

- 1. The induction system of the airplane removed the free water from the charge-air stream before it reached the carbureter deck except when excessive rain equivalent to 2.0 grams per cubic meter was encountered when the engine was operated at manifold pressures of 40 inches of mercury or higher.
- 2. Approximately 85 percent of the heat added to the charge air by the turbosupercharger was available for ice prevention or de-icing at the carbureter when the intercooler flap was closed.
- 3. The results of the ground tests were in agreement with the limiting-icing curves determined in the laboratory.

Aircraft Engine Research Laboratory, Fetional Advisory Committee for Aeronautics, Cloveland, Chio.

REFERENCES

- 1. Essex, Henry A., Koith, Wayne C., and Mulholland, Donald R.: Laboratory Investigation of Icing in the Carburetor and Supercharger Inlet Elbow of an Aircraft Engine. II Determination of the Limiting-Icing Conditions. NACA MR No. E5L18a, 1945.
- 2. Humphreys, W. J.: Physics of the Air. McGrew-Hill Book Co., Inc., 3d ed., 1940, p. 260.

	,							<u> </u>				-				, –								-		1	
1	1													Ì		L		Temp	eratı	re,	°F				-		
Run	Duration (min)	Pressure altitude (ft)	frue free-air temperature (OF)	Air density (slugs/ou ft)	Density ratio	Simulated rain	Ingine speed (rpm)	Manifold pressure (in. Hg absolute)	Mixture setting	Charge-air flow (lb/hr)	Fuel flow (lb/hr)	Puel-air ratio	Throttle opening (deg)	Waste-gate opening (deg)	Intercooler-flap position	Fuel at injection	Supercharger inlet	Center manifold	Gooling air	Alternate air	Accessory compartment	Spray water	Water drained from intercooler (1b/min)	Free water observe flowing to inter- cooler	Free water observed flowing to carbu-	Manifold pressure drop (in. Hg absolute)	Loss in charge- air flow (percent)
<u></u>	Series A																										
1 2 3 4 5 6 7 8	3 3 3 3 3 3 3 3	600 600 600 600 600 600 600	37 36 36 36 36 36 36 37	0.00243 .00244 .00244 .00244 .00244 .00244 .00243	1.022 1.024 1.024 1.024 1.024 1.024 1.024	None do do do do do	1800 2240 2200 2280 2600 2600 2800 2960	20.2 25.4 30.0 35.0 39.7 43.2 49.9 53.9	ARA AR AR AR AR AR AR	1957 3642 4463 5718 7228 8128 9780 10650	160 248 300 380 610 710 870 935	0.082 .068 .067 .067 .084 .087 .089	10 18 24 33 45 76 Open -do-	Open -dododo- 69 60 58	Open -dododododododo-	72 73 80 78 77 70 69 71	24 26 33 37 36 41 41 44	91 111 106 111 116 115 132 151	37 37 37 39 43 43 42	50 51 55 56 56 61 62 64	113 119 154 166 138 117 116 122	58 63 64 64 78 79 76					
	Series B																										
1 2 3 4 5 6 7 8	10 10 10 10 5 5 5	200 200 200 205 505 515 515 505	24 24 25 24 36 35 36 35	0.00253 .00253 .00253 .00253 .00245 .00245 .00244	1.065 1.066 1.064 1.028 1.028 1.028 1.028	Moderate do do do do do	1780 2200 2180 2280 2580 2600 2760 2920	20.1 25.0 29.7 34.6 39.9 43.6 49.6 54.3	AR AR AR AR AR AR AR	1873 3412 4374 5624 7435 8117 9868 10803	150 240 300 379 630 715 960 950	0.080 .070 .069 .067 .065 .068 .089	10 17 24 32 43 76 Open -do-	Open -dodododododo- 55	Open -do- -do- -do- -do- -do- -do-	65 67 70 74 59 63 62 62	24 27 34 40 36 46 49 47	84 101 98 102 107 117 126 139	26 31 32 31 42 41 41 42	39 40 42 42 59 62 63 63	161 179 207 210 141 145 151 158	70 75 76 77 99 104 101 96	0.006 .001 .023 .045 0	No No Yes Yes No No No	No No No No No No	0 1.1 .5 0	0.2 .3 3.4 1.7 0 0
													Seri														
1 2 3 4 5 6 7 8	10 10 10 5 5 5	180 170 170 170 520 530 520 500	24 23 24 25 34 33 34 37	0.00254 .00254 .00254 .00253 .00245 .00246 .00245	1.066 1.069 1.066 1.065 1.031 1.033 1.031	Heavy do do do do	1760 2160 2160 2240 2560 2560 2760 2920	19.8 24.9 29.9 34.9 39.9 43.5 49.8 53.7	AR AR AR AR AR AR AR	1760 3344 4454 5667 7342 8201 9846 10434	151 235 300 386 621 727 869	0.088 .070 .067 .068 .085 .089	10 17 24 32 43 76 Open -do-	Open -do- -do- -do- -do- 63 61	Open -dodododododo-	75 76 75 78 63 63 61 68	30 33 37 41 36 42 43 48	92 105 99 101 105 105 121 139	32 40	34 33 36 38 61 58 61 64	165 184 208 203 139 138 150 157	68 68 71 70 76 75 71 75	0.003 .002 .008 .007 .003	No No Yes Yes Yes	No No No No No No	0 0 .1 .4 0 0	0 •2 •7 0 0 •2 •2
1	10	150	25	0.00253	1,065	Excess	1800	19.7	AR	1928	155	0.080	10	Open	Open	68	24	83	26	37	148	64	0.007	No	No	0.1	0
2 3 4 5 6 7 8	10 10 10 5 5 5	150 525 525 1025 1025 1025 1025	25 34 36 29 28 29 28	.00253 .00245 .00244 .00243 .00244 .00244	1.064 1.031 1.027 1.023 1.025 1.024 1.020	do	2240 2200 2280 2520 2520 2520 2720 2880	25.0 29.8 34.4 40.0 43.2 49.7 53.8	AR AR AR AR AR AR AR	3495 4429 5518 7414 8019 9711 10772	245 298 368 620 690 850 945	.070 .067 .067 .084 .086 .088	17 25 33 48 76 Open -do-	-do- -do- -do- -do- 67 59	-do- -do- -do- -do- -do- -do-	72 79 83 58 58 56 67	32 34 42 35 42 43 45	109 101 106 102 98 114 133	32 32 32 33 32 32 32 32	36 53 52 48	174 167 188 131 132 140 149	69 72 73 58 58 58 58	.001 .031 .076 .159 .133 .093	No Yes Yes Yes Yes Yes Yes	No No No Yes Yes Yes	0 .4 .6 .4 0	.3 3.0 1.4 3.4 2.6 2.6
													Serie			1	1		'		••••	!					
1b 2b 5 4b 5b 6 7b 8b 9	10 10 10 10 10 5 5	825 825 870 860 860 860 860 860 860	31 30 30 30 30 31 30 30 30	0.00244 .00245 .00244 .00244 .00244 .00244 .00244 .00244	1.026 1.028 1.026 1.026 1.026 1.024 1.026 1.026	Excess do do do do do do	1852 1848 1852 2260 2280 2260 2740 2760 2740	20.4 20.3 35.0 35.0 35.2 49.8 50.0	AR AR AR AR AR AR AR	1935 1923 1923 5672 5690 5718 9815 9718 9743	160 160 160 380 380 385 870 865 865	0.083 .083 .083 .067 .067 .067 .089 .089	10 10 34 34 34 0pen -do- -do-	Open -dododododo- 60 60	Open Closed -do- Open Closed -do- Open Closed -do-	73 78 83 84 59	24 29 29 35 39 42 43 47	90 95 94 101 104 108 122 127 124	31 32 34 36 34	47 41 39 48 41 43 53 41 41	118 138 137 159 179 181 140 152 152	63 61 64 62 63 59 60 56	RY COM	No No Yes Yes Yes Yes Yes	No No Yes Yes Yes Yes Yes		

Automatic rich. blo water sprayed into intercooler duct.

NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

TABLE I - Concluded

RESULTS OF GROUND TESTS OF AIRPLANE INDUCTION SYSTEM - Concluded

	Station 1									Stati	on 2	Station 3									Station 4								
Run	Dew-point temperature (OF)	Dry-bulb temperature (or)	Wet-bulb temperature (op)	Relative humidity (percent)	Static pressure (in. Hg absolute)	Air density (1b/au ft)	Vapor content (lb/lb dry air)	Enthalpy (Btu/1b dry air)	Air velocity (ft/sec)	Dry-bulb temperature (OF)	Static pressure (in. Hg absolute)	Air density (lb/cu ft)	Dew-point temperature (OF)	Dry-bulb temperature	Wet-bulb temperature	Relative humidity (percent)	Static pressure (in. Hg absolute)	Air density (lb/cu ft)	Vapor content (1b/1b dry air)	Enthalpy (Btu/lb dry air)	Air velocity (ft/sec)	Dew-point temperature (OP)	Dry-bulb temperature (OP)	Wet-bulb temperature (OF)	Relative humidity (percent)	Static pressure (in. Hg absolute)	Air density (1b/ou ft)	Vapor content (1b/1b dry air)	Enthalpy (Btu/lb dry air) Air velocity (ft/sec)
	1 40	10	1 3 5	75	29.2	0.07791	0.00378	13.2	26	39	29.5	0.07837	32			A	29.4	0.07500	0.00373	17.1	36	30	50	49 1	50	29.3	0.07621	0.00378	16.2 32
1 2 3 4 5 6 7 8	52 33 33 31 31 33 32	38 40 41 41 41 43 43	35 36 37 37 37 38 38 38	68 69 69 63 63	29.2 29.2 29.2 29.2 29.2 29.2 29.2	.07760 .07744 .07744 .07744 .07714 .07714	.00378 .00392 .00364 .00364	13.6 14.1 14.1 13.8 14.2 14.6	26 49 60 77 97 110 132 144	40 41 41 41 43 43	29.5 29.4 29.3 29.3 29.4 29.3 29.4	.07837 .07821 .07784 .07763 .07758 .07761 .07719	32 32 32 32 29 29 33 33	54 53 56 56 56 58 65 80 89	44 43 45 45 44 48 56 60	42 40 40 31 27 18 14	29.1 28.6 28.2 27.0 27.7	0.07580 .07527 .07347 .07255 .06917 .06991 .07333 .07474	.00373 .00380 .00385 .00355 .00360 .00390	16.9 17.8 17.8 17.9 19.7 23.6	68 36 111 147 164 188	32 31 31 31 28 27 31 31	50 51 53 52 53 57 59	42 42 43 41 41 44 46	50 45 44 40 34	28.9 28.2 27.5 25.9 26.3 28.0 28.7	.07507 .07507 .07315 .07124 .06700 .06793 .07182 .07325	.00370 .00373 .00380 .00353 .00340 .00375	16.1 60 16.5 76 17.0 100 16.4 134 16.7 148 17.8 169
<u> </u>					22 21											В	100 51	0 (50)	*	14 0	42	00.1	25 1	461	40.1	00 el	0.00042	0.00040	13 1 30
12345678	21 20 20 24 24 24 24 27	26 27 28 27 41 41 41 42	24 25 25 25 34 34 34 36	76 65 76 47 47	29.7 29.7 29.8 29.8 29.3 29.3 29.3 29.3	0.08112 .08103 .08089 .08105 .07771 .07763 .07766 .07750	0.00229 .00218 .00214 .00214 .00268 .00268 .00268	12.7	24 44 56 72 101 109 130 145	25 26 31 29 35 37 35 35	30.0 30.0 29.9 29.6 29.7 29.5 29.4 29.3	0.08200 .08185 .08067 .08027 .07955 .07886 .07884	22 28 26 30 32 30 33	46 43 41 42 56 60 72 81	37 35 35 35 45 47 52 57	43 54 48 42 37 22 19		0.07818 .07761 .07618 .07505 .07052 .06979 .07336 .07658	0.00239 .00239 .00319 .00292 .00369 .00412 .00355	13.3 13.3 17.9 19.1 21.4	34 62 81 106 149 164 186 199	22 24 33 29 34 34 33 36	43 42 44 44 48 50 52 56	35 35 39 37 42 42 43 47	52 62 52 48	29.7 29.2 28.4 27.7 26.3 26.0 27.5 29.0	0.07843 .07712 .07468 .07300 .06855 .06757 .07130	.00261 .00404 .00351 .00462 .00468	15.0 73 14.2 96 16.7 135 17.1 149 17.1 168
																C													
1 2 3 4 5 6 7 8	22 23 19 16 27 27 27 27	25 26 27 39 38 39 42	24 24 24 24 34 34 34 35	87 75 64 60 67	29.8 29.8 29.8 29.8 29.3 29.3 29.3	0.08159 .08159 .08142 .08125 .07802 .07818 .07789	0.00240 .00252 .00202 .00174 .00308 .00310 .00269		22 43 57 73 98 109 132 140	25 24 26 27 37 34 35 36	29.7 29.7 29.6 29.7 29.6 29.4 29.3	0.08121 .08137 .08098 .08076 .07927 .07954 .07890 .07831	23 22 21 37 38 41 39	48 44 42 51 49 64 74	38 36 35 34 44 43 52 55	44 37 41 58 63 43	29.7 29.4 28.9 28.0 27.5 27.4 29.8 30.5	0.07763 .07738 .07599 .07404 .07139 .07136 .07536	0.00252 .00255 .00240 .00240 .00500 .00520 .00542 .00482	13.2 12.7 17.7 17.5 21.4	32 61 83 108 145 162 184 194	24 24 25 25 36 36 39 42	45 47 45 48	40 37 37 36 42 41 44	40 40 41 67 72 74	29.7 29.2 28.5 27.4 26.4 26.0 27.8 28.2	0.07698 .07654 .07471 .07195 .06898 .06815 .07269	.00279 .00294 .00502 .00525 .00545	13.9 54
														Ser	ies	D													
1 2 3 4 5 6 7 8	21 20 25 25 29 29 32 33	25 27 37 39 33 32 34 35	24 25 32 34 31 31 33 34	78 59 59 82 92 90	29.9 29.9 29.4 29.5 29.8 29.8 29.8 29.8	0.08181 .08150 .07853 .07853 .07752 .07773 .07742		12.2	25 45 59 73 100 107 130 145	25 31 36 36 33 33 33 34	29.9 29.6 29.6 29.0 29.0 29.0 28.8 28.8	0.08173 .08089 .07911 .07919 .07811 .07806 .07760	23 26 35 48 45 46 49 49	43 48 47 42 46 54 61	35 36 42 47 42 46 51 54	49 60 100 100 100 82	28.2 27.0 27.9	0.07819 .07751 .07489 .07378 .07127 .07322 .07635	0.00252 .00292 .00446 .00750 .00710 .00710 .00680	13.5 16.4 19.0 16.8 18.7 20.6	35 64 83 106 147 154 175 193	24 26 39 41 44 45 47	46 47 48 40 40 40	43	46 73 80 100 100	29.6 29.1 28.3 27.6 25.5 26.2 28.2 28.5	0.07801 .07642 .07407 .07202 .06773 .06961 .07437		16.3 136 16.0 143 17.0 162
L														Ser		E													
123456789	31 32 30 31 31 31 30 30 30	31 30 33 32 33 35 34 35	30 32	100 90 100 90 82 90	28.7 28.8 28.8 28.8 28.8 28.9 28.9 28.9	0.07748 .07778 .07791 .07744 .07760 .07744 .07734 .07750	0.00376 .00376 .00393 .00350 .00376 .00357 .00357	11.4 11.3 11.6 11.7 11.8 11.7	26 26 76 76 77 132 130	33 32 31 33 32 33 35 34 33	28.8 28.9 28.8 28.8 28.8 28.8 28.9 28.9	0.07763 .07789 .07819 .07763 .07778 .07763 .07747 .07763	33 35 36 36 41 44 46	51 50 49 44 43 46 57 55 56	43 42 42 41 40 42 49 49 51	50 55 78 78 72 55 65	29.1 29.1 29.1 28.1 28.1 28.1 29.9 29.8 29.9	0.07547 .07561 .07576 .07576 .07395 .07410 .07366 .07669 .07689	.00435 .00475 .00475	16.4 16.4 15.8 15.6 16.3 19.6	36 36 108 108 110 181 178 178	33 33 34 38 38 38 40 42 44	53 45 47 49 47 53	41 44 42 43 44 43 47 48	47 79 74 69 74 65	29.0 29.0 29.0 27.4 27.4 27.4 27.8 27.8 27.8	0.07585 .07496 .07496 .07195 .07166 .07138 .07281 .07196 .07250	.00530 .00530 .00530 .00550 .00595	17.3 32 16.7 98 17.1 99 17.6 99

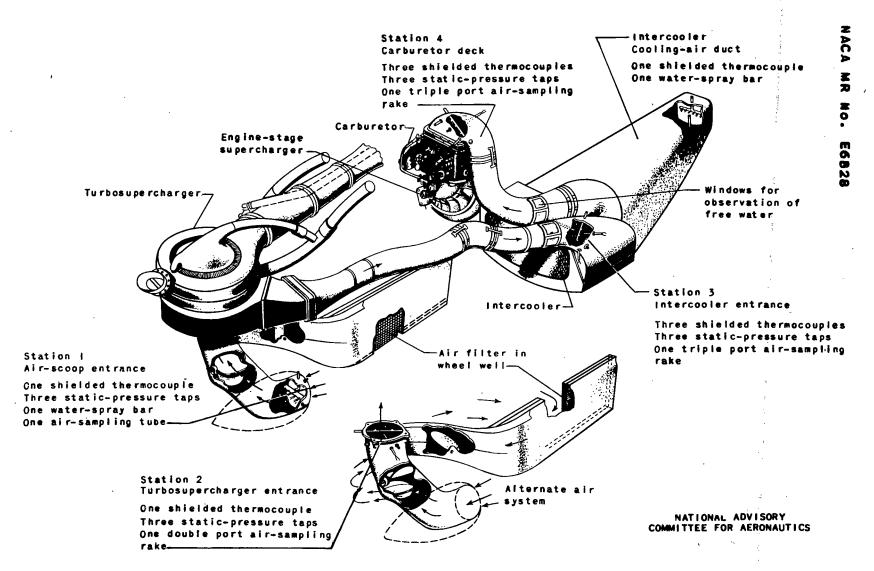


Figure 1. - Right-engine induction system of a twin-engine fighter airplane instrumented for ground icing tests.

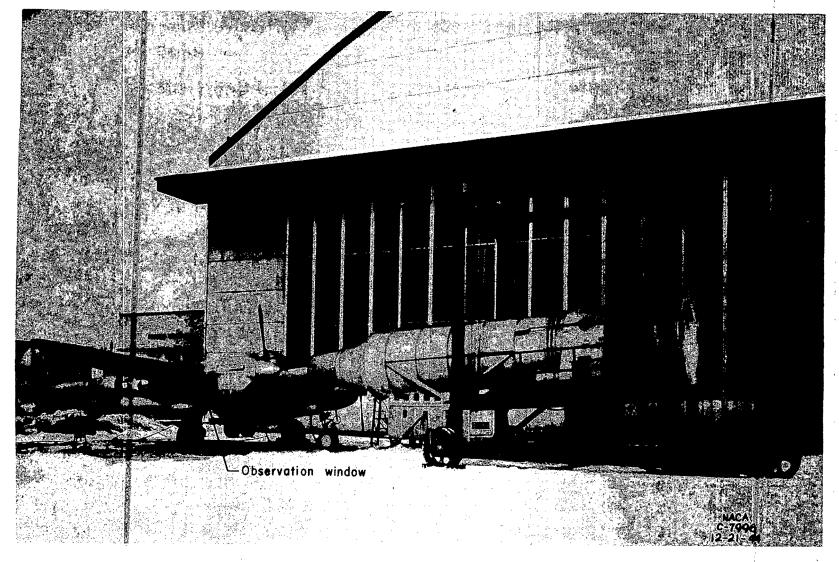


Figure 2. - Setup for ground tests of induction-system icing.

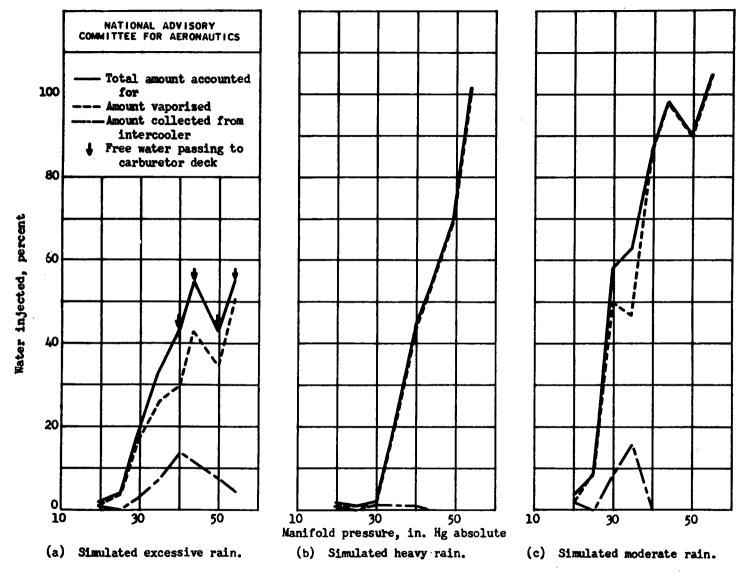


Figure 3. - Disposition of ingested rain in the induction system.

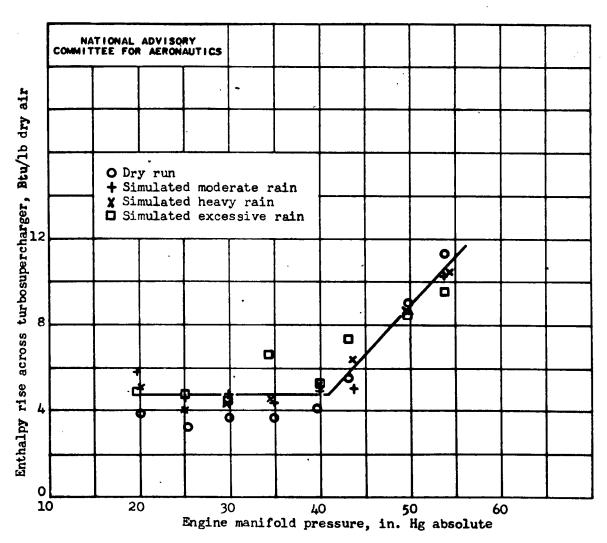


Figure 4. - Enthalpy increase across turbosupercharger in ground icing tests.




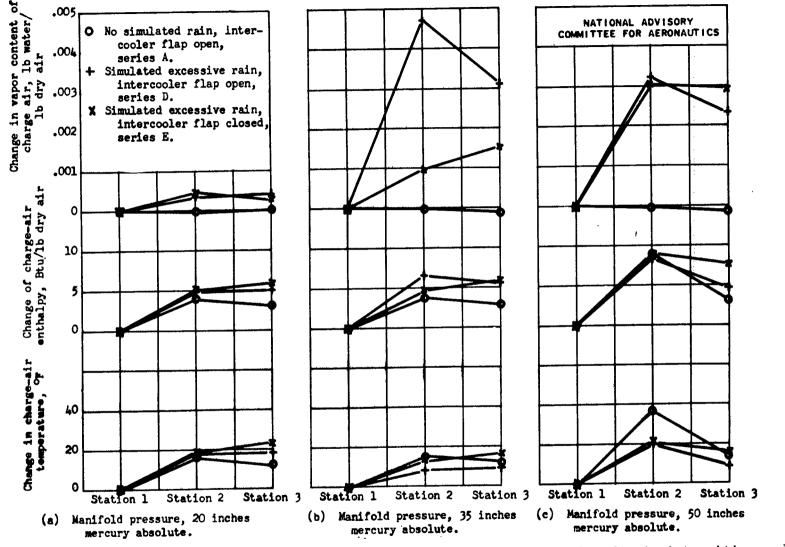


Figure 5. - Effect of induction system on charge air with varying simulated-rain intensities and engine power settings.

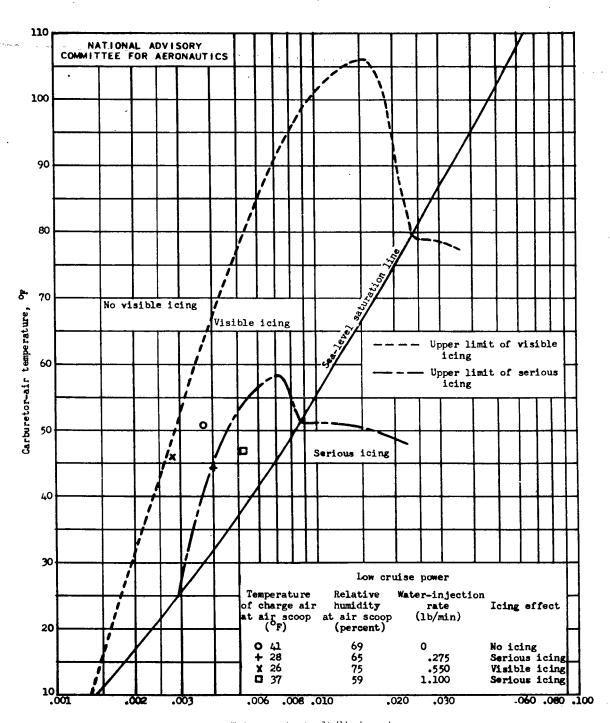

Water content, lb/lb dry air
Figure 6. - Comparison of laboratory and ground icing tests at low cruise power.

(Curves from laboratory tests of reference I.)

.....

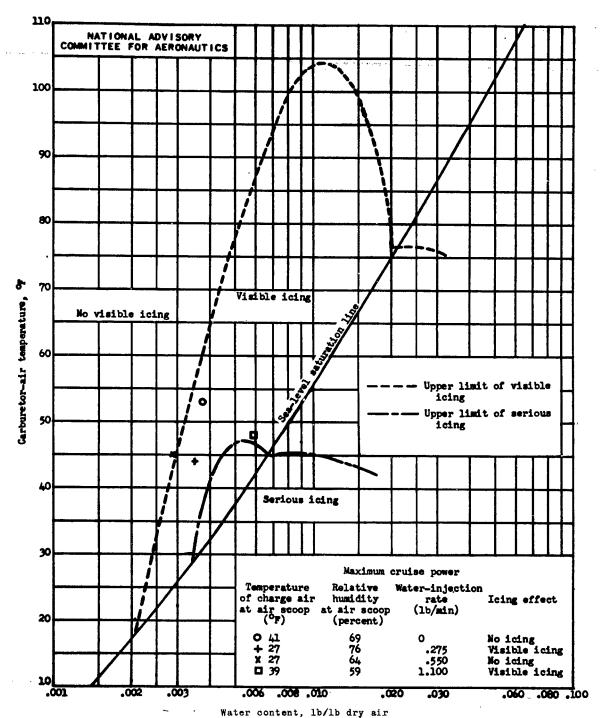


Figure 7. - Comparison of laboratory and ground icing tests at high cruise power. (Curves from laboratory tests of reference 1.)

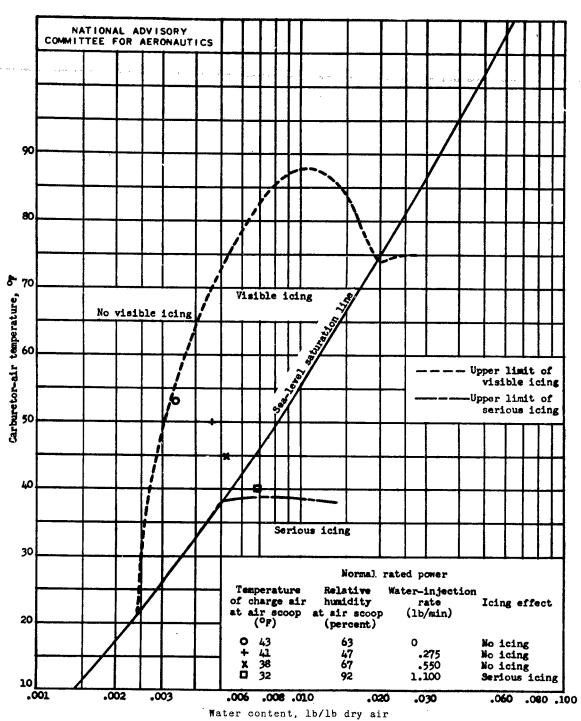


Figure 8. - Comparison of laboratory and ground icing tests at normal rated power.

(Curves from laboratory tests of reference 1.)

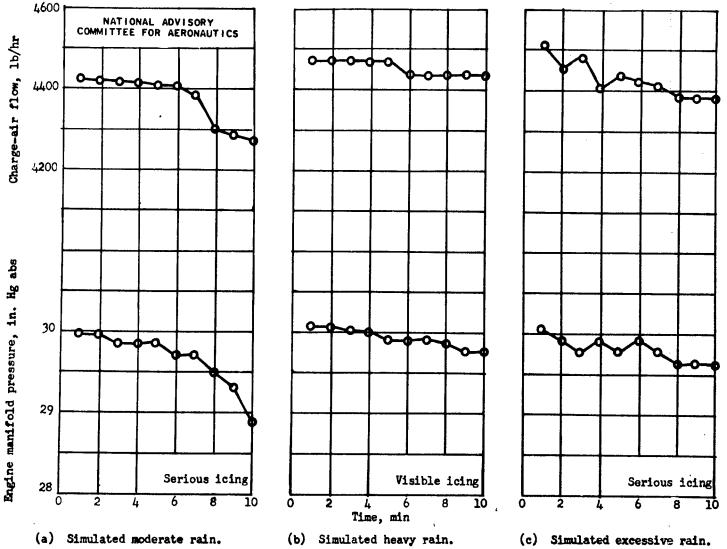


Figure 9. - Induction-system icing at low cruise power.

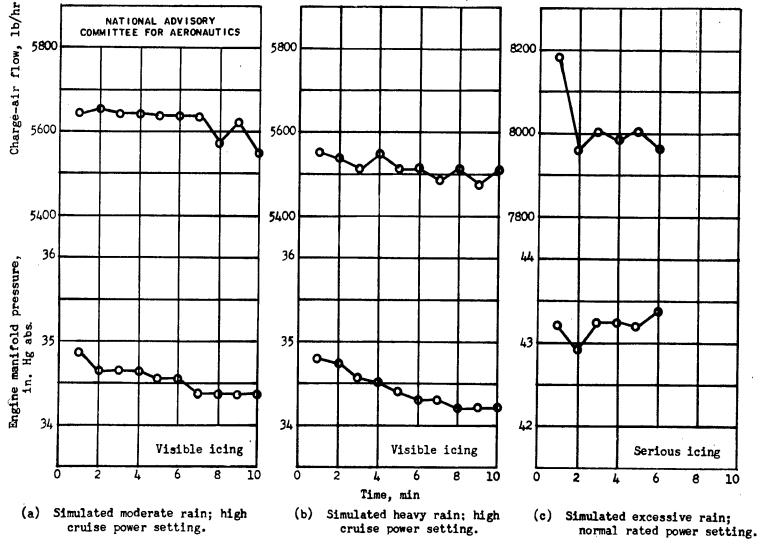


Figure 10. - Induction-system icing at high cruise and normal rated conditions of engine power.

3 1176 01363 833⁻